



CHIEF ENGINEER

Official Publication of The Chief Engineers Association of Chicagoland
SINCE 1934

May 2018

SHORT-CIRCUITING THE HIGH COST OF TRANSFORMER UPGRADES

**Stopping Corrosion Under Insulation
in Global Oil and Gas Facilities**

**Construction Firm Takes Steps to
Cultivate a New Workforce**

Stopping Corrosion Under Insulation in Global Oil and Gas Facilities

Corrosion Under Insulation (CUI) is the root cause of many of the global petrochemical industry's most serious problems including forced shutdowns, lost production, early repair and replacement, as well as safety and environmental consequences that can cost millions of dollars per incident.

CUI, which involves the corrosion of vessels or piping beneath insulation due to water penetration, is insidious because it can remain undetected until the insulation is removed for inspection or leaks occur. Water penetration can result from many causes including monsoons, rain, flooding, wash downs, and sprinkler systems, as well as exposure to steam, humidity, or frequent condensation and evaporation of atmospheric moisture.

From upstream wells, risers, drilling rigs, or offshore platforms, to midstream pipelines, storage, and liquefied natural gas (LNG) terminals, to downstream refineries, fighting CUI and major corrosion has been an uphill battle and a major cost in the operation of oil and gas facilities, according to

NACE International's "International Measures of Prevention, Application and Economics of Corrosion Technology (IM-PACT)" study.

Fortunately, even when traditional coatings have allowed CUI and corrosion to occur, a new approach can stop the corrosion to dramatically extend facility and equipment life in oil and gas industry applications.

Stopping Existing Corrosion and CUI

Traditional corrosion protection typically involves applying polymer paints and rubber-type coatings. Such methods create a physical barrier to keep corrosion promoters such as water and oxygen away from steel substrates. However, this only works until the paint is scratched, chipped, or breached and corrosion promoters enter the gap between the substrate and coating. Then the coating can act like a greenhouse — trapping water, oxygen and other corrosion promoters — which allows the corrosion to spread.

Some of the world's largest petrochemical companies, including China Petroleum & Chemical Corporation, however, are finding success with a new approach toward stopping CUI and corrosion.

China Petroleum & Chemical Corporation, commonly known as Sinopec Corp., is one of the largest integrated energy and chemical companies in the world, with upstream, midstream and downstream operations. In Sinopec's Jiangnan Oilfield projects, located in China's Jiangnan Plain in Hubei province, there are numerous facilities for oil and gas extraction, transport, and storage.

However, with Hubei's sub-tropical monsoon climate, CUI and corrosion are serious issues that shorten equipment life and require excessive maintenance. In this environment, traditional coatings have been ineffective, and stopping corrosion



AMesse Supply and LAURAL Supply
Since 1899
312-733-4848 312-666-1890

COMMERCIAL • INDUSTRIAL • INSTITUTIONAL
Plumbing & Heating Supplies

TOTO

APOLLO Valves

RIDGID

Fluidmaster

American Standard

BOBRICK

PIPE & ACCESSORIES
FITTINGS & VALVES
PLUMBING SPECIALTIES
TOILETS & FIXTURES
FAUCETS & REPAIR PARTS
WASHROOM ACCESSORIES
CHEMICALS & ADHESIVES
PUMPS, GASKETS & SEALS
MOTORS & BELTS
EXPANSION JOINTS
COMPENSATORS
VIBRATION ELIMINATORS
TOOLS
DRAIN CLEANING MACHINES
HOSE & HOSE ACCESSORIES
WATER COOLERS & PARTS
WATER HEATERS & A/C UNITS
GAUGES & THERMOMETERS

CUT TO ORDER PIPE

Rockford Separators

AC Smith

MOEN

BEMIS

CHICAGO FAUCETS

SLOAN

opubelt

Competitive Pricing • Fully Stocked Warehouse • We Deliver!

Phone **(312) 733-4848** Fax **(312) 733-4876**

email **Sales@AMesseSupply.com**

2500 W. Lake Street • Chicago, Illinois • 60612



HART, TRAVERS & ASSOCIATES, INC.

325 EISENHOWER LANE NORTH LOMBARD, IL 60148
TELEPHONE (630) 261-1166 FAX (630) 261-1818
info@htareps.com www.htareps.com

<p>Representing</p> <p>Zoeller Pump Company</p> <p>Mansfield Plumbing Products</p> <p>Sioux Chief</p> <p>Lenox Tools</p> <p>Irwin Tools</p> <p>Prier Products</p>	<p>Blanco</p> <p>AK Industries</p> <p>Magic Plastics</p> <p>IPEX/Canplas</p> <p>Ideal Tridon</p>
--	---

that is already underway is often the last resort.

To extend production and the service life of assets already experiencing serious CUI or major corrosion, on two sample projects Sinopec turned to EonCoat, a spray applied inorganic coating from the Raleigh, North Carolina-based company of the same name. EonCoat represents a new category of tough, Chemically Bonded Phosphate Ceramics (CBPCs) that can stop the corrosion, ease application, and reduce production downtime even in very wet, humid, monsoon-prone conditions.

In contrast to traditional polymer coatings that sit on top of the substrate, the corrosion resistant CBPC coating bonds through a chemical reaction with the substrate, and slight surface oxidation actually improves the reaction. The surface of steel is passivated as an alloy layer is formed. This makes it impossible for corrosion promoters like oxygen and humidity to get behind the coating the way they can with ordinary paints.

Although traditional polymer coatings mechanically bond to substrates that have been extensively prepared, if gouged, moisture and oxygen will migrate under the coating's film from all sides of the gouge.

By contrast, the same damage to the ceramic-coated substrate will not spread corrosion because the carbon steel's surface has been chemically transformed into an alloy of stable oxides. Once the steel's surface is stable (the way noble metals like gold and silver are stable) it will no longer react with the environment and therefore cannot corrode.

Visible in scanning electron microscope photography, EonCoat does not leave a gap between the steel and the coating because the bond is chemical rather than mechanical. Since there is no gap, even if moisture was to get through to the steel due to a gouge, there is nowhere for the moisture to travel. This effectively stops atmospheric corrosion and CUI on carbon steel assets.

The corrosion barrier is covered by a ceramic layer that further resists corrosion, water, fire, abrasion, impact, chemicals, and temperatures up to 400 °F. Beyond this, the ceramic serves a unique role that helps to end the costly maintenance



Some of the world's largest petrochemical companies are finding success with a new approach toward stopping CUI and corrosion.

cycle of replacing typical barrier type coatings every few years.

(Continued on page 18)



Abron
FILTER AND SUPPLY
Serving the Engineering Community

- Air Filters
- V-Belts
- Plumbing Replacement Parts & Fixtures
- Ice Melt Products

CHICAGO | sales@abronsupply.com
PHONE: 773.775.3695 | FAX: 773.763.1985



ANCHOR MECHANICAL, INC.

HVAC • Air Conditioning • Heating • Plumbing
Fans • Temperature Controls • Chillers • Boilers
Ventilation • Refrigeration • Building Automation Systems
Variable Frequency Drives

Sales • Service • Installation

24 Hour Service
(312) 492-6994

Visit us on the web:
www.anchormechanical.com





Some of the world's largest petrochemical companies are finding success with a new approach toward stopping CUI and corrosion.

"CUI is the silent killer," explains Merrick Alpert, "President of EonCoat. "The insulation creates a terrarium on the steel in which corrosion is guaranteed to occur if traditional coatings are used. And the insulation then hides the corrosion from being detected until it's too late."

Sinopec's first sample project using the CBPC coating involved addressing CUI on a 500 cubic meter petroleum storage tank in an oil-extraction facility in the Jiangnan Oilfield.

While the storage tank's original coatings were wrapped beneath a mineral wool insulating layer, due to rain, condensation, and moisture invasion through the damaged insulating layer, these coatings had failed, allowing CUI in a number of areas.

After peeling off the insulating layer, the metal surface underneath was prepared by sandblasting, then the CBPC coating was applied. The application has effectively stopped the CUI issue and is expected to extend the storage tank's functional life for years to come.

After the success of the first project, Sinopec opted to utilize the CBPC coating to address serious corrosion on a container-type water injection pumping station in another Jiangnan Oilfield facility. Because of the pumping station's outdoor



SYNERGY Mechanical Inc.

4202 Warren Avenue
Hillside, IL 60162

Mike Suggs ~ Phone: 708.410.1004
msuggs@synergymech.com

Air and Hydronic Balancing ~ TABB Certified
Duct Leakage Testing ~ Fume Hood Certifications
LEED OA System Testing ~ IDPH Certifications



IS YOUR BUILDING PROTECTED?

Keeping Chicago's businesses and workforce protected is our primary concern. Trust Hill/Ahern Fire Protection to be your single-source provider for all your fire protection needs including:

- New System Design
- Fire Equipment and Extinguishers
- Fabrication and Installation
- Inspections and Emergency Service
- Special Hazards System
- Fire Pump Testing

As a jointly owned partnership between Hill Mechanical Group and Ahern Fire Protection, we offer customers more than 200 years of combined industry experience.

11045 GAGE AVENUE, FRANKLIN PARK, IL 60131
PHONE: 847-451-5000 FAX: 847-451-5011
info@hillgrp.com www.hillgrp.com/fire-protection

CITY WIDE POOL AND SPA, INC. (773) 631-7946

Providing a full range of pool and spa services. Including:

- All Equipment Repair
- Plumbing/Electrical Troubleshooting
- Leak Detection
- PVC Liner Installation
- Resurfacing/Painting/Plaster
- Monthly Maintenance/Chemicals Delivery

Quick Response • Quality Service • Reasonable Rates

location with very high saline alkali content soil, along with a very humid container environment, shutdown for corrosion maintenance was typically required every three years.

A traditional three-coat system was routinely used to maintain corrosion protection for the pumping station, so coating application took at least three days to allow drying time for each layer. Including surface preparation, total required maintenance downtime was at least seven days, which hindered production.

One of the greatest benefits of the CBPC coating, however, is the quick return to service that minimizes facility downtime. The time saved on an anti-corrosion coating project with the ceramic coating comes both from simplified surface preparation and expedited curing time.

With a typical corrosion coating, near white metal blast cleaning (NACE 2/SSPC-SP 10) is required to prepare the surface. But with the ceramic coating, only a NACE 3/SSPC-SP 6 commercial blast is typically necessary.

With traditional coatings, extensive surface preparation is required and done a little at a time to avoid surface oxidation, commonly known as "flash rust," which then requires re-blasting. But with the CBPC coating, the flash rust is actually desirable. There is no need to "hold the blast." The reason for this unique CBPC characteristic is due to the presence



Fighting CUI and major corrosion has been an uphill battle and a major cost in the operation of oil and gas facilities.

(Continued on page 20)



MVB
Mechanical Vibration &
Balancing Services, Inc.

MVB Services
is committed to helping you run your building
more efficiently with less down time.

- Vibration Analysis
- Laser Coupling Alignment
- Shop & Field Dynamic Balancing
- Vibration Condition Monitoring Programs
- Wheel, Shaft, Bearings & Motor Replacements
- Fan Engineering, Rebuild & Replacements
- Industrial & Commercial Start Up Service
- Vibration Monitoring Systems/Installation
- 24 Hour Emergency Service

For more information contact jorseno@mvb-inc.com

Experience • Expertise • Reliability
630-530-0353
414 West Fullerton Ave., Elmhurst, IL



Christopher
GLASS & ALUMINUM, Inc.

24/7 Emergency Service—Board Up
Complete Door Maintenance—Revolving Entrances
Glass Replacement—Storefronts—Curtainwalls
Mirrors—Interior Glass Doors—Sidelites

2 Locations to Serve You Better—Chicago & Elmhurst

312-256-8500


NEWS

of iron in the rust, which helps to create the magnesium iron phosphate alloy layer. It is this alloy layer that allows CBPCs to so effectively protect carbon steel from corrosion.

In contrast, a corrosion-resistant coating for carbon steel utilizing the ceramic coating in a single coat requires almost no curing time. Return to service can be achieved in as little as one hour, which can potentially save hundreds of thousands of dollars per day in reduced oil and gas facility downtime.

Because of these unique properties, total coating application including surface preparation of the Sinopec pumping station will take two days and the asset can be put into service immediately.

With CUI and corrosion a perennial problem for oil and gas facilities with massive carbon steel structures, utilizing CBPC coatings that can control corrosion for decades and reduce downtime will only help the bottom line.

For more information, call 754-222-4919; visit www.eoncoat.com; or write to EonCoat, LLC at 551 Pylon Drive, Unit D, Raleigh, NC 27606. 

GOT A STORY TO TELL?


HAVE YOU BEEN PART OF A PROJECT MAKING A BUILDING MORE EFFICIENT OR SAFER?

DO YOU HAVE A NEW PRODUCT OR SERVICE YOU THINK CHIEF ENGINEERS NEED TO KNOW ABOUT?

DO YOU KNOW A LONG-TIME MEMBER WHO'S WORK SHOULD BE SPOTLIGHTED?

WE WANT TO KNOW!

CALL CHIEF ENGINEER AT
708-293-1720 OR SEND AN EMAIL TO
EDITOR@CHIEFENGINEER.ORG
AND LET US KNOW ABOUT YOUR
PROJECT, PRODUCT, SERVICE OR
ANYTHING OTHER INDUSTRY NEWS YOU
THINK CHIEF ENGINEERS NEED TO KNOW
ABOUT

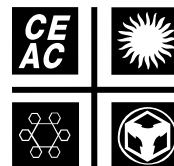

*'Heated' about your **chiller's** performance?*

CHILL OUT

We've got you covered with
50 TECHNICIANS
and **80 YEARS**
OF EXPERIENCE!

HVAC SERVICES

MAINTENANCE

DESIGN/BUILD SOLUTIONS

RETROFIT SOLUTIONS



AIR COMFORT

708-345-1900 | AIRCOMFORT.COM