

# TEST REPORT -12329 A

## Assured Testing Services

198 River Road Ridgway, PA 15853 USA

Ph: (814) 773-3224 Fax (814) 773-3225

michelesinger@assuredtestingservices.com



TESTING CERT# 2012.01

### CLIENT BILL TO

### CLIENT SENT TO

ISO 17025 Certified

<b>BILL TO:</b> NCWILSON--1388	OurSupplier ID
Eoncoat LLC	
4000 Airport Dr	
Wilson NC 27896	
USA	Supplier Code
Attn:	Ph: 252-360-3110

<b>SENT TO:</b> NCWILSON--1388	OurSupplier ID
Eoncoat LLC	
4000 Airport Dr	
Wilson NC 27896	
USA	Supplier Code
Attn:	Ph: 252-360-3110

**Test Report#:** 12329 **Entry Date:** Monday, March 03, 2014

**Contact:** Sameer Patel

**PO#:** 2038

*Salt Spray Exposure IAW ASTM B117.*

*Panels were numbered and scribed by Assured Testing Services.*

*See attached photos.*

*REVISED TEST REPORT TR12329 A: Revised per customer request.*

Part Test Information										
PART NUMBER	LOT NUMBER	S#	SAMPLE DESCRIPTION							
TEST SPECIFICATION NAME		TEST PROCEDURE NAME			HOURS		CYCLES			
TEST RESULTS	INDATE	OUTDATE	TESTCNT	RETCNT	REQ	COMP	REQ	HOURS	COMP	
3" x 5" Steel Panels										
Unspecified										
	04-Mar-14	06-May-14	3	3	1500	1500				
<i>Results: Slight to moderate degrees of swelling occurred during testing and were present at the 1500 hour exposure removal. However, all points of swelling self healed within 24-48 hours after removal from exposure. No progression of creep from scribe. Panel 2 exhibiting red rust in scribe at the 1000 hour interval.</i>										
<i>Panel 1</i>										
<i>Panel 2</i>										
<i>Panel 3</i>										
<i>Requirements: No pass/fail criteria. Provide observation.</i>										

Michele Singer

Revision# 1.10 Date 12/16/10


End Of Report

Quality Assurance Administrator

The results stated above relate only to the specific items tested. Information and statements in this report are derived from material, information, and/or specifications furnished by the client and exclude any expressed or implied warranties as to the fitness of material tested or analyzed for any particular purpose or use. This report is confidential property of our client and may not be used for advertising purposes. This report shall not be reproduced except in full, without written approval of this laboratory. This recording of false, fictitious or fraudulent statements or entries on this document may be punished as a felony. Sample remnants are retained for a minimum of 6 months following issuance of test results, at which point they will be discarded unless notified in writing by the client. Any client claims or damages arising from the use of information in this report are strictly limited to the cost of the services provided by Assured Testing Services.

**Assured Testing Services, Ridgway, PA  
TR 12329 A Eoncoat LLC**

**Photos of (3) three samples exposed IAW ASTM B117-11 Salt spray testing.**

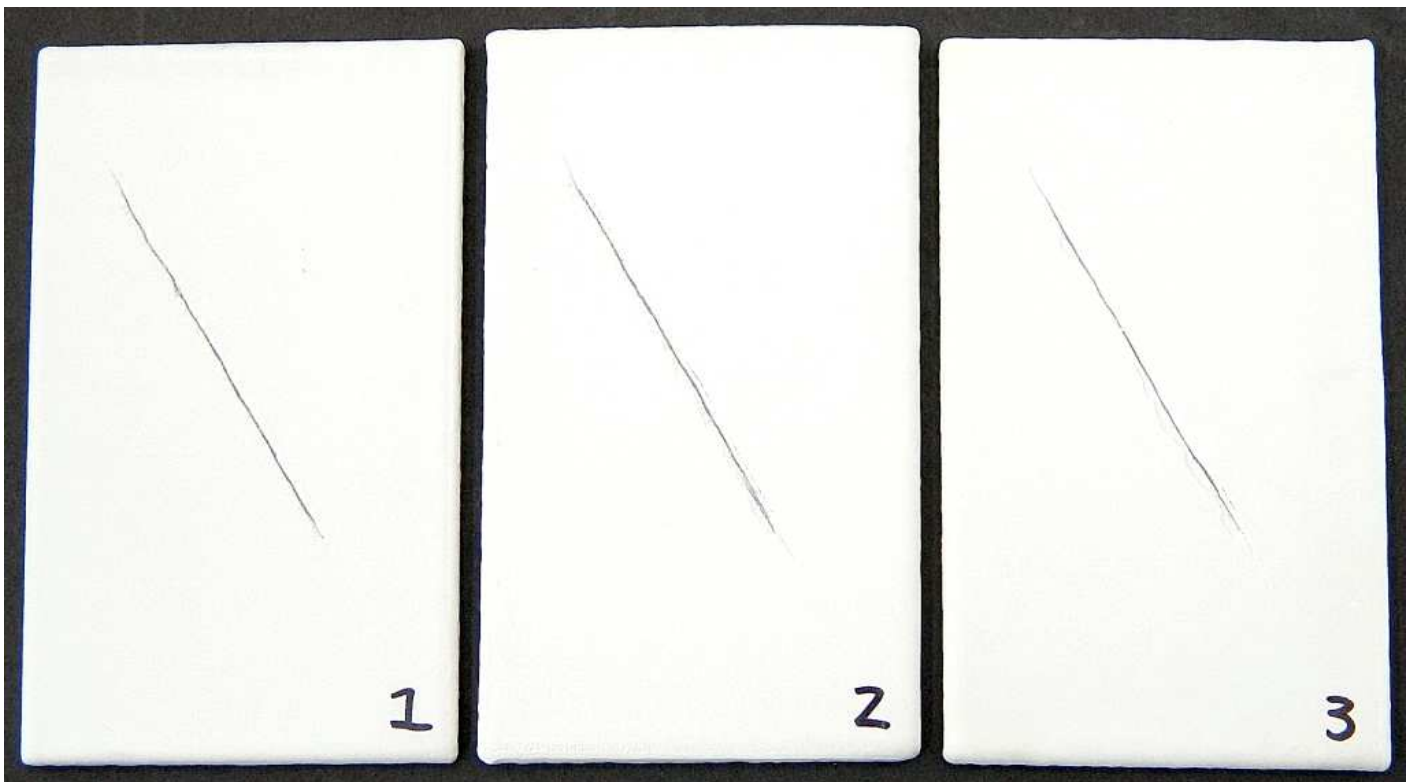


**Initial photo - before exposure. (See above.)**



**Samples at 500 hour exposure IAW ASTM B117-11. (See above.)**

**Assured Testing Services, Ridgway, PA**  
**TR 12329 A** **Eoncoat LLC**

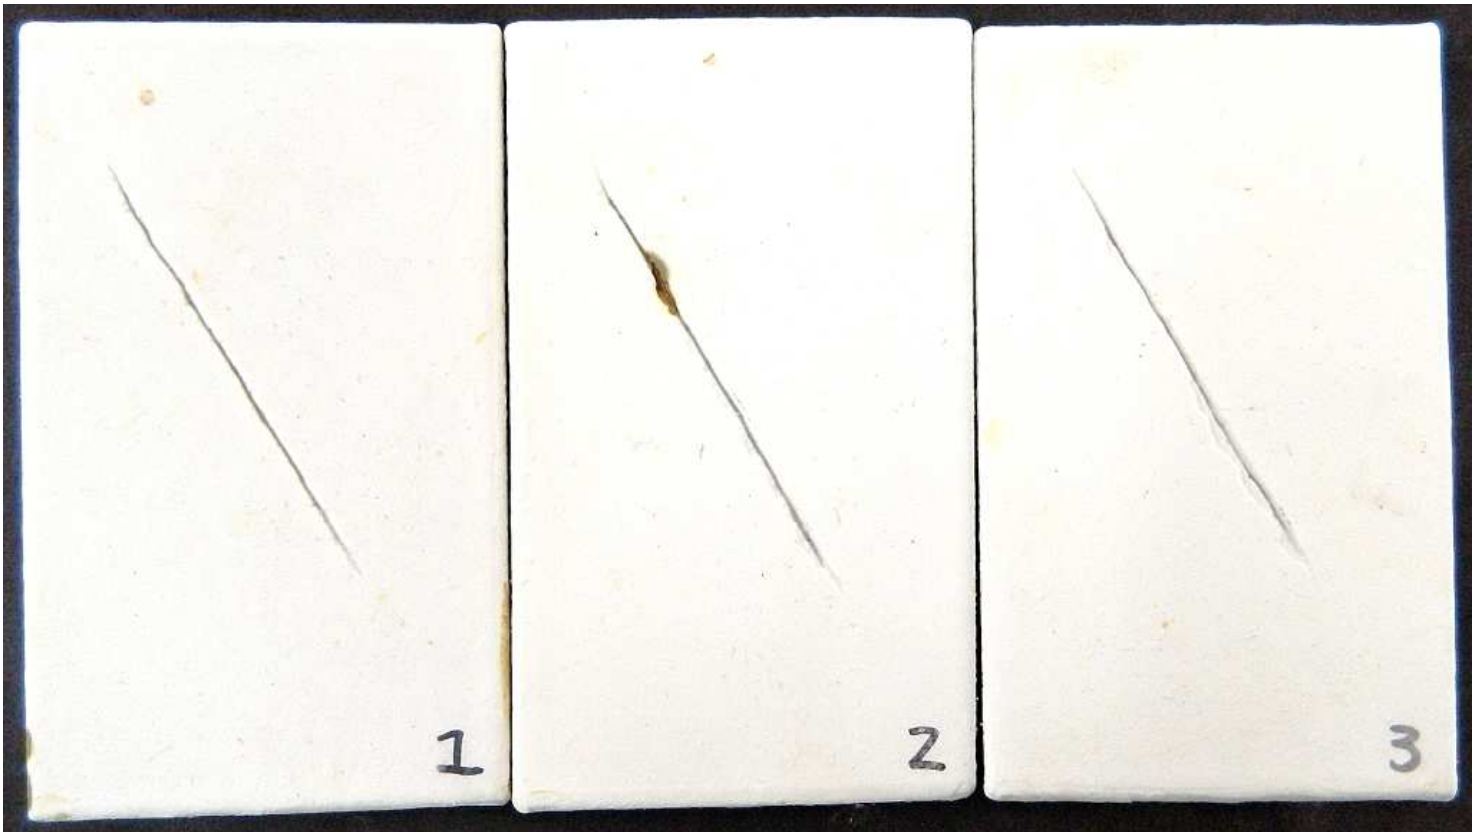

**Samples at 1000 hour exposure IAW ASTM B117-11. (See above.)**



**Sample at 1500 hour exposure IAW ASTM B117-11. (See above.)**

End of photo pages